

Collection

REFLEX

Article


RX320_23

Description

Wall mounted spout

Box Dimensions Weight 220x120x40 mm 0.2 kg Finishes CC CF •00 MB SS CS BRUSHED BLACK CHROME BLACK CHROME MODERN BRONZE BRUSHED NICKEL CHROME GOLD IS 08 \bigcirc BO NP) II ORR BRUSHED PALE GOLD BRUSHED GOLD ANTIQUE COPPER OPL RS ON ●SR BRUSHED ROSE GOLD ROSE GOLD NATURAL BRASS PLATINUM



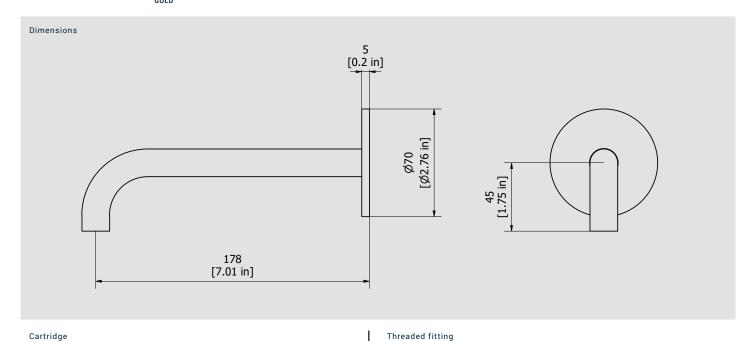

G1/2" male

Aerator Flow Rate (+/-10%)

M16.5x1 1 BAR 2 BAR 3 BAR 3.2 l\min 3.8 l\min 3.8 l\min

Production

Main body is a single hot stamped pieces

Material

BRASS

According to CuZn42 (CW510L)
Max Lead content: 0.2%










Parts list				
ITEMS	CODE	DESCRIPTION	FIN	QTÀ
1	CPX320CCN_23	Preassembled wall spout Ø18		1
1.1	AQ0014147	Perlator PCA cachè laminar 1 GPM	-	1
		(44.3358.010)		
1.2	AC0011995	Spout-out M18x1 M16.5x1 Ø18 L194	F	1
1.3	AC0018064-TI	Ring Ø70 Ø18.5 H5	F	1
1.4	AQ0006997	OR 18x2 NBR 70 SH	-	1
1.5	AS0016647	Fitting G1/2"M M18x1F L18	G	1

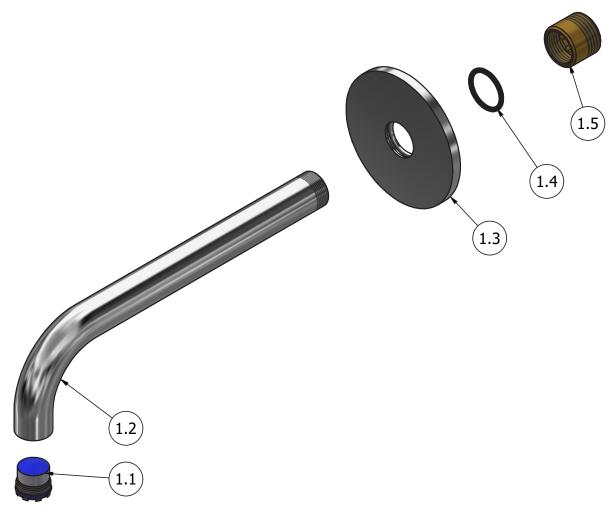





WARRANTY

All IB Rubinetterie SpA products are warrented for 10 years from the date of purchase, for the following cases:

- Defects of casting, porosity and chrome plating.
- Operating defects caused by incorrect fabrication.

The warranty provides for repair or replacement of products with fabrication defects recognized by our technical office. There is no other type of compensation anche the merchandise must be returned FOB our werehouse. The warranty only cover surface defects (scartches, dings, etc.) on fitting that have not been installed and used, returned in its original packaging with all components. O-ring, gasket seals and components subject to wear proportional to use are warranted for 2 years.

The warranty is void in the following cases:

Error installing and putting the product into service.

Deterioration of finisched surfaces due to use of cleaning products containing acids or abrasive substances. Deterioration of surface with finishes other than chrome plating. Their durability is, in fact, dependent on the user's care and gentleness of use.

Deterioration of the fitting due incorrect installation.

Improper repairs and maintenance performed without the company's prior authorization.

The warranty from IB Rubinetterie SpA is not renewable.

Cleaning

We recommanded cleaning the finish surfaces with water and soap, using a soft cloth. Do not use detergents that cointain hydrochloric acid or abrasive substances.

